

IP-4d

Release Notes

Version 1.05
26.02.2025



IP-4d Release Notes

Table of Contents

Version 1.05.....	3
Version 1.04.5.....	8
Version 1.04.4.....	8
Version 1.04.3.....	8
Version 1.04.2.....	8
Version 1.04.1.....	9
Version 1.04.....	10
Version 1.03.....	14
Version 1.02.....	18
Version 1.01.....	21



IP-4d Release Notes

Version 1.05

26.02.2025 – identical to 1.05-rc10

New Functionality

1.05-rc9

- Extended log now tracks NTP reference server changes

1.05-rc8

- Added a new button to the Overview page to reset the counters of all decoders

1.05-rc6

- Added a configuration option to file input sources to play only once (no loop)
- Optional FM tuner: added the possibility to signal an active TA via a GPO (new GPO switch source in GPO configuration)

	State	Inverted	Source	Parameter
GPO 1	☐	☐ OFF	RDS TA signaling	FM/DAB tuner 1 RF-1
GPO 2	☐	☐ OFF	Remote command	---
GPO 3	☐	☐ OFF	Alarm	---
GPO 4	☐	☐ OFF	Alarm	---

Save

- Scheduler: Enables the execution of various actions at defined times. Currently available actions are activating/deactivating a decoder source
- Last settings change: The time can be read out as a UNIX timestamp or human readable date. This is also displayed on the Global page:

Settings Download

Last settings change: 30.10.2024 06:03:32 (UTC)

Generate settings file:

1.05-rc4

- If the optional SAT tuner is installed, the LCD screen will now show additionally a status page with reception information:

SAT STATUS					
RF1 - DVB-S2 QPSK 22000 2/3, 1303.000 H					
RF STATE	Locked	C/N	17.5 dB	BER	0
RF LEVEL	-38 dBm	EB/NO	10.2 dB	FE	274 kHz
RF2 - DVB-S QPSK 22000 Auto, 1788.000 U					
RF STATE	Tuning	C/N	0.0 dB	BER	--
RF LEVEL	-99 dBm	EB/NO	--	FE	--

- Started to add the possibility to get a counter history on the Overview page via a small icon next to the label. It's more or less a shortcut to the extended log, showing you only the entries for the counter of this




IP-4d Release Notes

input source. Currently it's added to the "Missed" and "Timed out" counter, others should follow.

IP					
Src address	Src port	Bitrate	Packets/s	Jitter	
0	0	0	0	0.0 ms	
Missed	PER	MDI	Timed out	Max size	Buffer
0	0.0 %	0.0:0.000	0	0	0 ms

1.05-rc2

- Enhanced the loudness metering to show either the current values or the max hold values

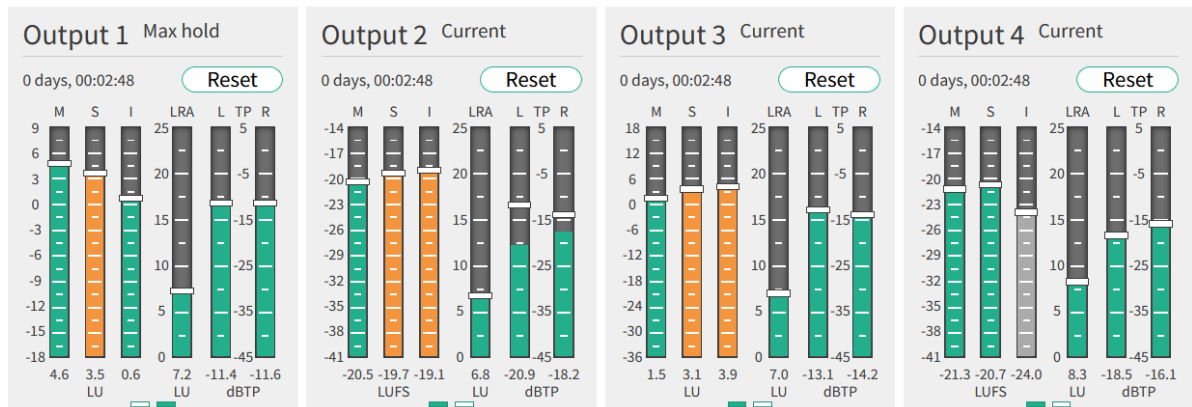

- New silence mode for elementary stream inputs: when enabled, empty packets will be inserted in case of missing stream input (like the "Generate Null samples" option for AES/EBU inputs, when no input is connected)
- Added the possibility to clear the extended log

1.05-rc1

- Added optional Loudness metering/monitoring according to EBU R 128 for the audio outputs





IP-4d Release Notes

- The reference levels and scales can be configured individually via Interface Settings / Audio:

Interface Settings

Audio

Interfaces Loudness

Settings

Meas.	Enable	Source	Ref. level	Scale	True Peak
1	☒	Output 1	-23 LUFS	EBU +9 LU	☒
2	☒	Output 2	-23 LUFS	EBU +18 LUFS	☒
3	☐	Output 3	-23 LUFS	EBU +9 LU	☐
4	☐	Output 4	-23 LUFS	EBU +9 LU	☐

Additionally there are of course new alarms for the loudness monitoring:

System Settings

Alarm

Device SAT Tuner ASI Input Inputs Outputs Encoder Decoder Loudness

Audio Output Loudness Measurement

	Enable	Priority	Value(s)	T1	T2	SNMP	LED	GPO
Audio 1 - Momentary loudness	☒	Emergency	> 8.0 LU	1 s	1 s	☐	☒	---
Audio 1 - ShortTerm loudness	☒	Emergency	> 3.0 LU	1 s	1 s	☐	☒	---
Audio 1 - Integrated loudness	☒	Emergency	Reference level ± 1.0 LU	60 s	30 s	☐	☒	---
Audio 1 - True Peak	☒	Emergency	> -1.0 dBTP, Channels: L + R	1 s	1 s	☐	☒	---

- Added optional TLS/SSL encryption for Live Listening (to support access via https from within the web interface)
- Added uptime values for RTP/SRT input streams as separate values readable via external APIs
- Added support for HD Radio to the optional Multiband tuner

Input Source

HD-Radio Test

RF1, HD Radio - 97.50 MHz

Audio Input

AAC

Type SR Bitrate Mode SW

HEV1 48000 128k stereo 16

FM / HD Radio

Acquired HD RF level 28 dBμV

SNR DAAI CdNR

21 dB 60 68

Additionally there are new alarms for HD Radio: HD acquired, HD DAAI and HD CdNR

Changed functionality

1.05-rc10

- In case of limited screen width, the new hamburger menu is now more prominent. Additionally, the collapsed menu can be pinned to stay on the screen even in case of limited screen width.
- The PER (packet error/loss rate) for RTP inputs was formerly measured in an interval of 1/10 of the T1 time of the packet loss switch criteria time (where the default is 60s resulting in a default measurement interval of 6s). The measurement does now adapt to the type of incoming stream and its number of packets per second to allow for a resolution of the PER of 0.1% (meaning 1 of 1000 packets). To be able to measure that at least 1000 packets need to be the measurement interval which might result in the PER not updating very frequently.

1.05-rc8

- The menu of the web interface does now collapse to a hamburger menu in case screen width is limited
- The RDS Databridge configuration for the optional FM tuner is moved to a separate tab in the dialog
- Show Dual Streaming block on Overview even if FEC is enabled



IP-4d Release Notes

1.05-rc1

- Consolidated TCP/IP page to only have one “Save” button
- The event log page does now also refresh automatically when it is initially empty

Fixed Issues

1.05-rc10

- The silence mode available for elementary stream input sources was not working immediately after enabling it and after a reboot
- Prevent duplicate VLAN IDs on same interface
- Enhanced compatibility to some WAV files
- Decoder stops working with ancillary data decoding enabled after ancillary data is sent (if DTE output is configured; since 1.05-rc8)
- PTP for unicast configuration improved
- Enhanced compatibility of the Icecast client in case of FLAC Icecast server content

1.05-rc9

- For the audio output configuration, the clock source selection was not available when the signal type was set to Analog, although the clock source still affects the output speed control
- RTP input source: when the input stream changes (e. g. due to an encoder restart), RTP reception might not resume, showing an input bitrate of 0, even if the new stream is received by the device (since firmware version 1.05-rc8)
- The decoder buffer level alarm was broken in firmware 1.05-rc8

1.05-rc8

- Bunch of internal improvements and optimizations
- Security enhancements
- Headphone output may be distorted
- FLAC codec did not work in combination with SRT
- SRT in caller mode doesn't always connect reliable with the SRT listener
- Not currently active TS/Demux backup sources may show wrong ancillary data on Overview page in case a private PID is used as ancillary source
- When changing the ancillary data configuration the ancillary output doesn't work afterwards or the device may even crash
- When changing a TS/Demux source and switching to the Overview page the device could crash with certain transponders
- Enhanced stability
- Check minimum SRT passphrase length
- “Jumping” level meters after decoder backup switching on Overview page
- TS/SRT decoding was broken
- Live Listening: switching the input source while listening may not work reliable
- Loading settings might not activate all input source settings
- Avoid alarms of inactive channels due to reduced channel count In “Analog/Digital” device mode

1.05-rc7

- The optional FM/DAB tuner did not work in the IP-4d (distorted audio)



IP-4d Release Notes

- Live Listening: switching the input source while listening may not work reliably
- Loading settings might not activate all input source settings

1.05-rc6

- Automatic codec detection for TS/Demux input sources may not signal correct AAC type
- Fixed possible application crash when loading settings or loading factory settings
- Individual status values for Livewire input sources did not work via external APIs
- E-aptX decoding inside TS did not work
- Live Listening might be done with wrong audio speed (when switching between different input sources)
- Enhanced compatibility of the optional HLS client/decoder to certain streams
- Decoder: a backup in “Standby” mode isn't activated when an inferior backup is in “Active” mode
- Optional AES67 outputs had a generic name in the SAP announcements – now the audio output name configurable via Codec / Input Sources / Interfaces gets used (if set)
- Optional AES67 outputs: improved startup behavior, inhibiting a possible output burst at startup

1.05-rc5

- Fixed a problem on the Codec page, sometimes not allowing to switch between the “General” and the “Switch Criteria” tabs in the input source configuration dialogs
- A disabled decoder (switched to Off) could still show a green/valid status on the Overview page instead of the grey/inactive status

1.05-rc4

- Icecast client: https Icecast streams with credentials may have problems with authentication
- (Limited) support for Internet Explorer 11 was broken

1.05-rc2

- A change of the PCM multichannel offset of an elementary stream input was not taken into account (only after disabling/enabling the input source or rebooting the device)

1.05-rc1

- The optional ASI input may not detect the TS coming from the ASI signal connected to the ASI input after a reboot of the device
- Fixed high number of DNS requests with NTP synchronization enabled
- Fixed T1/T2 alarm times not editable
- ProMPEG FEC decoder let main input stream fail, if one FEC port offset is set to 0
- Dedicated status values for TS/SRT did not work at all
- "Automatic" decoder config did not work when relying on SAP as the source for the codec detection (e. g. for AES67 inputs)



IP-4d Release Notes

Version 1.04.5

21.06.2024

Fixed Issues

- Fixed a problem with the AES67 output on device startup (in case a file is used as input source)

Version 1.04.4

20.06.2024

Fixed Issues

- Fixed AES67 output clock inaccuracy

Version 1.04.3

13.06.2024

Fixed Issues

- The AES67 outputs may exhibit timestamp jumps in certain cases, e. g. when a SIP call is terminated
- The optional Dolby decoder did not work correctly and produced audio glitches
- Fixed some problems with the optional Live Listening feature

Version 1.04.2

07.06.2024

Changed Functionality

- File playback did only support files < 2 GB
- Added support for WAV files with BW64/RF64 file format

Fixed Issues

- PTP might not work correctly in certain environments
- PTP might not be active after loading a settings file with a corresponding configuration
- Changing the SNMPv3 authentication protocol (MD5 <-> SHA1) did not work
- After IP address change the SRT decoder (in Listener mode) did not receive any SRT streams
- Headphone Downmix did not work in Analog/Digital Mode



IP-4d Release Notes

Version 1.04.1

29.05.2024

Fixed Issues

- When doing “Load factory settings”, the user account passwords were not reset to default
- When loading a settings file, the user account passwords were not taken from the loaded settings file
- The optional low symbol rate SAT tuner did only work with symbol rates down to 100 kSym/s. This limit is now reduced to 64 kSym/s
- The metronome icon on the Overview page (which should signal external clock usage and its state) was not shown appropriately
- The AES67 output may provide packets that are “too early” in certain situations



IP-4d Release Notes

Version 1.04

24.05.2024 – identical to 1.04-rc7

New Functionality

1.04-rc6

- Added parity configuration for DTE outputs

1.04-rc5

- Added traceroute possibility to the web interface (Network Settings / TCP/IP / Tools)

Network Settings
↳ TCP/IP

General Tools

Ping

Settings

Destination: heise.de

Interface: Data 1

Count: 5

TTL: 255

Data size (0=default): 0

Start Stop

Output

```
PING heise.de (193.99.144.80): 56 data bytes
64 bytes from 193.99.144.80: seq=0 ttl=247 time=10.199 ms
64 bytes from 193.99.144.80: seq=1 ttl=247 time=10.105 ms
64 bytes from 193.99.144.80: seq=2 ttl=247 time=9.901 ms
64 bytes from 193.99.144.80: seq=3 ttl=247 time=9.894 ms
64 bytes from 193.99.144.80: seq=4 ttl=247 time=9.773 ms

--- heise.de ping statistics ---
5 packets transmitted, 5 packets received, 0% packet loss
round-trip min/avg/max = 9.773/9.974/10.199 ms
```

Traceroute

Settings

Destination: heise.de

Interface: Data 1

Max. hops: 5

Time to wait: 3

Start Stop

Output

```
traceroute to heise.de (193.99.144.80), 5 hops max, 38 byte packets
1 192.168.96.1 (192.168.96.1) 0.212 ms (64) 0.221 ms (64) 0.192 ms (64)
2 mx204-2.ham.purtel.com (185.39.84.9) 7.292 ms (254) 4.488 ms (254) 4.079 ms (254)
3 * * *
4 100.83.140.3 (100.83.140.3) 3.414 ms (252) 3.503 ms (252) 3.845 ms (252)
5 be100.c350.f.de.plusline.net (80.81.193.132) 10.210 ms (251) 10.138 ms (251) 10.077 ms (251)
```

- Added event log entries when loading a settings file or loading factory settings
- Settings files can also be uploaded via the Storage page

Status
↳ Storage

Internal Storage NFS Storage **aws S3 Storage**

Data storage

72%

1758.1 MB free of 6282.7 MB

Audio files Settings files

Upload file Note: Only for file size < 100MB (for bigger files use SFTP)

Supported types: Audio , firmware  and settings  files.

Browse / Drop file No file selected Upload

Filename	Date (UTC)	Size	
IP-4c_740.000145_config.xml	12.03.2024 08:53:52	4.4 MB	Delete
IP-4c_740.000855_config.xml	12.03.2024 08:54:24	3.8 MB	Delete



IP-4d Release Notes

- When generating a settings file on the Global page you can now not just only download the file, but also save it to the internal storage. You can also directly change the name of the settings file.

- Once there are settings files on the internal storage the user can select one of the stored files instead of uploading one and load it via the new consolidated Upload/Activate section, thereby having a sort of preset functionality, allowing to quickly switch between different configurations.

- Added an event log entry when setting a GPO by GPI tunneling
- 1.04-rc1
- Added entries to the extended log in case of CC (continuity count) errors in transport stream decoding

Changed Functionality

1.04-rc6

- The PTP configuration did only allow to configure a single IP interface, providing no backup functionality in case PTP fails on that interface. Now all interfaces configured for streaming data (under Network Settings / Services) will be used for PTP, automatically switching between the interfaces when needed
- Updated Fraunhofer libraries to latest versions
- RDS Databridge (optional): If no RDS update is received for a period of time, the Databridge can switch the RDS encoder to a "Fallback DSN".

1.04-rc5

- The different upload sections on the Global web page (Firmware, Settings, Rights, SSL Certificate) were consolidated to just one section allowing to upload every of the four kinds of files

- The manager user can be granted limited access to the Global web page, allowing just to switch between different configurations
- Cleanup of SRT / TS/SRT Overview info block fields
- Reduced sensitivity of the jog wheel for better user experience when doing configurations via the LCD menu
- Changed Load Factory Settings via LCD menu to new method without reboot



IP-4d Release Notes

1.04-rc1

- Loading settings via the web interface will show a warning when trying to load settings from a different device type. The settings can still be loaded, though, as many settings are of general nature.

Fixed Issues

1.04-rc7

- AES67 output did not work, when no External Clock was configured (since firmware V1.04-rc6)
- The audio buffer configuration did not work with small audio buffer values for the TS/Demux input sources. The overall delay was significantly higher compared to our old FlexDSR series for certain audio streams (with more than one audio frame inside one PES frame). This should now be almost on par.
- Elementary stream input sources with multicast addresses were re-initialized when saving although no relevant changes were made

1.04-rc6

- Fixed audio buffer drift in case of enabled external clock (PTP/1PPS) and enabled sample rate converter
- Web interface: session timeout did no longer work
- SRT input stream will be only restarted if parameters were changed
- Standby input sources were no longer activated when needed - Fixed
- UDP ancillary output status did not always work
- When switching from PTP to internal clock, the audio outputs had a short distortion
- Changing the sample rate converter configuration of one audio output did disturb all audio outputs
- Web interface: on the Login page the user name field now has the focus on page load to allow immediate typing without the need for the additional click into the field
- Web interface: for elementary stream and TS/IP input sources not applicable configuration options are getting hidden in case of UDP protocol selection
- Icecast client: enhanced compatibility to OGG/FLAC streams
- RDS Databridge (optional): the EON TA functionality does now respect the EON PI configuration and will not react on EON Ta from a service with a different PI then the configured one
- Improve robustness of the TS decoder (could hang up completely on bad input data, stopping TS processing completely)
- TS private data decoding may stop after bad weather and disturbed SAT reception
- file playback can be disturbed (since firmware 1.04-rc1) -> the minimum configurable audio buffer has been increased to 100ms

1.04-rc5

- GPI Forwarding may have some issues when an input source with GPI Forwarding enabled is used for more than one audio output on different backup levels
- Fixed Icecast client issues with Icecast streams with ContentType audio/mpegurl
- When switching between different elementary streams (e. g. Ravenna streams) the device may crash and gets unresponsive
- General security and access control improvements
- Again: Improved PTP synchronization of AES67 output, improving AES67 output stability
- PTP did only work with domain 0
- Enhanced compatibility to AAC encoded in short frame mode



IP-4d Release Notes

- Changing just the audio buffer level of an input source is not (always) applied
- Fix the possibility that the TS decoder does not provide the service list (showing 0 services)
- After settings updates (loading a settings file or loading factory settings) input source changes may not be applied
- TS/Demux: the audio buffer is automatically adjusted to the PES frame length if the configured value is too low to avoid audio buffer underruns
- DTE output configuration with Private Data MPE demux can disturb other DTE output

1.04-rc1

- Under high CPU load IP packets may get lost and reported as missed
- Under high CPU load the audio output may get distorted (event log showing FPGA underruns)
- When doing “Load Factory Settings” and unplugging the power immediately after completion, the new (default) settings might not have been saved
- The AES67 output may still not be synchronous to PTP
- High CPU load in case of incomplete TCP connections (Icecast/HLS)
- Optional HLS decoder: Improved compatibility
- Web interface: the page heading may show an incorrect title when some menu entries are disabled



IP-4d Release Notes

Version 1.03

02.02.2024 – identical to 1.03-rc8


New Functionality

1.03-rc3

- SAT Tuner: added the frequency offset to the status parameters
- SRT: added source address and port as well as uptime (time since last connection start) to the decoder status information
- When loading settings via the web interface it can now optionally include the TCP/IP configuration
- Added the IP interface link status to the IP interface selection in the different configuration dialogs
- Added speed selection (Auto / 1000 Mbit / 100 Mbit) to the TCP/IP interface configuration. Sometimes auto negotiation does not work correctly. In this case a manual configuration might help.
- Added missing VLAN support to SRT configurations
- For security reasons the password hashes of the user accounts are no longer stored as MD5, but as bcrypt hashes. The migration will be done automatically.
- Added the possibility to update the firmware locally from USB
- Added the fan status to Status→Device in the web interface (needs System Controller firmware 1.07)

1.03-rc1

- Added the possibility to configure individual switch criteria per input source
Instead of having one global switch criteria configuration per input source type each input source can now have different switch criteria, e. g. different levels and times for the audio silence detection. To allow this each input source configuration dialog now has an additional tab allowing to enable and configure individual switch criteria.
This change did also introduce a new visual appearance for the configuration dialogs.
- The fully automatic switching between the different decoder ranks (Main, Backup1-3) in both inferior and superior direction can now be deactivated. It will then allow you to configure, if the backup switching between two decoder ranks should be automatically done in both inferior and superior direction (as it's done by default) or if the automatic is only allow to switch in inferior direction.
The switch back to a superior input rank will then not be done automatically but only on user request (e. g. after checking the superior input signal manually).

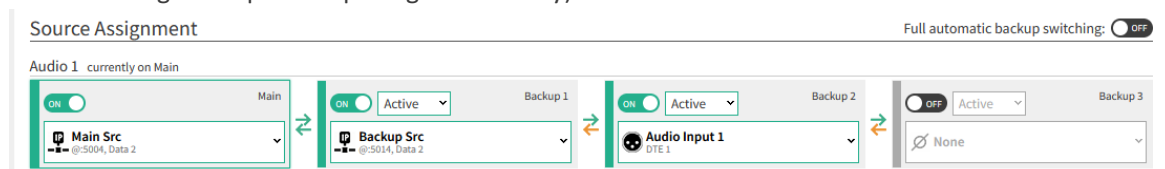

- Added the possibility to locally load settings from and save settings to USB via the LCD menu.
The settings loading from USB can be done in two different ways – one without and one including the TCP/IP configuration.
- Added the possibility to access the latest 50 event log entries via external API (e. g. SNMP)
- Added SNMP traps for detected local GPI and remote GPI (GPI Forwarding) changes
- Added the possibility to enable an automatic firmware update check, giving a hint in the web interface, that a new firmware is available without the need to manually check it



IP-4d Release Notes

- Some minor improvements to logging of SRT drops and connect in extended log

Changed functionality

1.03-rc3

- The individual gain adjustments per input source can now be done with a resolution of 0.01 dB steps
- “Load factory settings” from within the web interface does no longer require a reboot

1.03-rc1

- Loading settings via the web interface will no longer require a reboot of the device, but will be done very quickly (within a few seconds)

Fixed Issues

1.03-rc8

- SPN and SFN did not work, 1PPS input status was still broken

1.03-rc7

- When doing “Load Factory Settings” some settings may not be back to default, but only after a reboot
- When uploading and activating a settings file some settings may not be activated correctly and may need a reboot
- Icecast streams with FLAC codec did not work
- Audio on headphone may be distorted if listening to an audio input with disabled SRC
- Long Icecast URLs containing the ‘&’ character failed to be imported via the settings file
- The audio output can get distorted when the audio outputs have the digital reference input enabled and a decoder input source is providing audio with a sample rate different than the one from the audio reference input (can happen e. g. with a SIP input source and an incoming call with e. g. G.711/722 as the codec)
- The AES67 output may not be synchronous to PTP
- Fixed none working 1PPS input status since firmware 1.03-rc6

1.03-rc6

- Fixed potential high amount of audio errors due to FPGA audio buffer underrun
- Fixed visual problems with the TS Demux service select update/refresh
- SAT tuner alarms were swapped between RF1 and RF2

1.03-rc5

- The web interface can get unresponsive on the Overview page, when an input source description is longer than one line and changes its content regularly (e. g. in case of file playlists)
- The AES67 output may not be synchronous to PTP
- Individual switch criteria changes of an input source were not applied immediately
- Wrong individual switch criteria for the file input sources

1.03-rc4

- A bad combination of two changes introduced in firmware 2.14-rc5 (migrating password hashes from MD5 to bcrypt and doing “Load factory settings” without reboot) could lead to the impossibility of being able to login to the web interface after having done “Load factory settings”.
A reboot would fix this problem, but one might not be able to initiate the reboot due to the impossibility to login to the web interface.



IP-4d Release Notes

- Ancillary data from Icecast input sources may not be put out on device startup
- The audio error counter may not increase for very small buffer underruns
- PTP clock synchronization for AES67 output improved
- DNS configuration per interface did not work via LCD menu
- Optional SAT tuner: if reception gets interrupted due to e. g. bad weather conditions for a longer period of time, the device might fail to re-establish tuner lock (with the normal dual tuner EXM01)

1.03-rc3

- External clock configuration: a reconfiguration from an already configured and valid clock source (e.g. from PTP to PPS) was not handled correctly
- SNMP:
virtCslAudioDecoderStatusAudioDecoderstate (1.3.6.1.4.1.21529.1001.35.2.3.4.37.3.4096.1.7) did not always provide the correct state
- Optional decoder ancillary data is now also shown on the Overview page if the input source is not the currently active one
- Configuration changes done in the Codec dialogs may not get saved, when the dialog is left while the new (individual) Switch Criteria tab is selected
- SAT tuner status may get unavailable (e. g. after disabling/enabling a SAT input source)
- Extended log entries for missed RTP packets may have empty stream names, if the packet was lost in a redundant (DualStreaming) or FEC stream
- Saving settings to USB may fail, if the USB stick is removed too quickly after the OK message is shown
- Fix visible name field in TS/Demux configuration when in "Service from list" mode
- Device could hang up when the audio file belonging to a file input source is not present (e. g. after loading a settings file)
- The new individual switch criteria did not work correctly (were not applied correctly)
- Fixed a high CPU load problem when many AES67 receive streams are configured
- MPEG TS decoder: enhanced audio decoding compatibility of RTP streams inside MPE
- Synchronized Playout did not work correctly without SFN license
- Ember+ improvement for read-only items (in the virt subfolder)
- Some special characters in the name fields of the input sources etc. could mess up the display of the defined settings in the web interface

1.03-rc2

- Fixed a problem with the second audio output when the sample rate converter is activated and a digital reference input is used (the audio buffer will not be stable and drifting slowly, either running empty or increasing)

1.03-rc1

- With the optional low symbol rate SAT Tuner the device still could fail to re-establish tuner lock and the audio outputs stay silent if reception gets interrupted due to e. g. bad weather conditions
- SNMP monitoring status was not reset to "disabled" if all input sources are getting disabled
- SNMP monitoring status / Warning LED / Relay were not reset (e. g. for the "Audio – No Input Data" alarm) if all input sources are getting disabled
- The optional SAT Tuner alarms are no longer triggered if the tuner is inactive (unused)
- Alarm "No Input Data" did not check if PES/MPE data is present in case of TS/Demux input source



IP-4d Release Notes

- Fixed "good" check for ES input source switch criteria "No input data" (T1 time was not considered correctly)
- Fixed "good" check for file input sources (were always bad since latest firmware when "No Input Data" switch criteria was activated)
- Fix AAC-ELD(v2) ES decoding not working when Decoder type is explicitly set accordingly
- File playback from playlist was broken since latest firmware 1.02
- VLAN interfaces were not correctly activated after a firmware update
- When updating the recovery bundle the wait page was shown endlessly
- FEC: Fix audio frames being unnecessarily recovered in case of 1x4 matrix

Known bugs

- xHE-AAC: Ancillary data and GPIO Forwarding does not work



IP-4d Release Notes

Version 1.02

27.07.2023

New Functionality

- Added compatibility to Qbit GPIO Forwarding in ancillary data
- Added Mono Downmix option to headphone output
- Added a new status value providing the delta time between the two streams in RTP DualStreaming setup
- Added configuration option to possible Mono Downmix for the audio outputs, allowing to select the Mono output being either a mix from left and right channel or only the left or right channel
- Added Mono Downmix option to headphone output
- Decoder backup switching events do generate now event log entries (finally) with the cause of the backup switching (in case of inferior backup level activation) and the backup level which was activated. A corresponding SNMP trap will also be sent out.
- The event log web page will now update automatically when new events arise while having the page open
- First steps to more advanced / extended logging:
For some events, which were previously only counted (like missed packets) there's now the possibility to check the point in time when these events occur. There's a new "Extended Log" tab on the Log web page, which shows these events. Currently we added events for RTP Rx start, RTP missed packets, RTP unrecovered packets and RTP Rx timeout and SRT connect/disconnect.
Like the counters this extended log is volatile, meaning it is cleared after a reboot. If syslog is enabled, these events will however also be sent out to syslog, making them externally persistent.
- Released REST API that enables customers to use an Open API 3.0 compliant API to control and monitor 2wcom's devices.
 - More info about Open API 3.0 can be found [here](#).
 - The API can be enabled and browsed on page "External APIs" -> "REST API".
 - The openapi.json for the device and additional documentation can be found on the devices page "External APIs" -> "REST API".
- Added alarm/monitoring for the optional ASI input
- Added interface (and VLAN) selection to the SNMP trap manager configuration

Changed functionality

- Invert setting in GPO configuration had no influence on reported GPO state via Livewire
- RTP dual streaming improved
- Reported Livewire GPI/GPO states are now high in default state and low in triggered state
- SRC/DST name size increased for Livewire Routing Protocol (LWRP) from 15 to 25 characters
- The Icecast Server did still answer with "ICY 200 OK" to a connection request and only for certain user agents / browsers with "HTTP/1.0 200 OK". For some time now the ICY answer is however deprecated and should no longer be used, so we do now always answer to a connection request with the HTTP answer, thereby hopefully improving the general compatibility of the Icecast server to certain clients.



IP-4d Release Notes

Fixed Issues

- Fix status problems of optional DAB tuner (RF level etc. are reported as faulty sometimes, although this is not true)
- SAT Tuner: Fixed BER calculation for low symbol rate single tuner
- Improved stability (jitter) of AES67 output
- RIST receiver improved for low latency transmissions, avoiding sometimes quite aggressive retransmission requests
- RIST receiver improved for dual streams with encoder send delay
- Switching VLAN activation without modification doesn't work
- Control services are not correctly setup in VLAN environment
- Digital interface output level can be displayed greater than 0 dBFS when a gain value > 0 is configured and the audio level is high
- Fixed shown name of radio input source during Drag&Drop
- Drag&Drop of TS Data Demux input sources did not always work
- SAT tuner: if reception gets interrupted due to e. g. bad weather conditions, the device still could fail to re-establish TS decoding and the audio outputs stay silent
- Fixed Livewire routing protocol LWRP not working after changing the IP address of the device
- MPE decoder: MPE ancillary data output was not working
- Fixed possible timestamp display problems in new Extended Log
- Decoder input sources with backup policy "Active when needed" might not get deactivated again when activating superior source
- MPEG TS Decoder: optional decoding of 192kHz PCM in PES mode without external clock did not work
- Ancillary data output for SRT input sources may not work when having configured "Audio Output X" as input source for the Ancillary Output
- Changes to the headphone config via web interface were not applied
- The new "Auto Refresh" of the event and extended log web page sometimes didn't work
- Livewire stream names with more than 15 characters could crash the system if the Livewire Routing Protocol LWRP is active
- SNMP get for virtual IP address nodes did always return 0.0.0.0 (e. g. virtCslIpcfgtempCtrlIp, OID 1.3.6.1.4.1.21529.1001.35.2.42.43.1)
- RIST receiver improved for RTP streams, where the encoder has RIST disabled (could lead to audio buffer not building up)
- RIST didn't work in dual streaming setup for the redundant line
- RTP: Overall packet lost counter could be too large in rare cases
- Fixed compatibility issues when MM01 is the audio encoder and RTP packet fragmentation is activated via "RTP max payload"
- MPEG/TS decoder: enabled the possibility to decode audio streams not announced via PAT/PMT automatically without the need to set the codec type manually
- MPEG TS decoder: fixed compatibility of private data TS decoding if the PID is not announced via PAT/PMT
- MPEG/TS decoder: enhanced audio decoding compatibility of RTP streams inside MPE
- Changing just the LNB config for a SAT input source was not applied



IP-4d Release Notes

- Optional Live Listening feature did not work with Safari browser
- A configured source IP for SSM (Source Specific Multicast) could not get deleted
- When switching between different web interface menu items the page will now always scroll back to top
- DTE baudrate changes were not applied immediately, but only after a reboot - Fixed

Known bugs

- xHE-AAC: Ancillary data and GPIO Forwarding does not work



IP-4d Release Notes

Version 1.01

31.01.2023

New Functionality

- Added gain configuration to all input sources to e. g. allow alignment of main and backup sources
- Added playlist support (m3u, m3u8, pls) to the file input source
- Added VLAN support to the Icecast client input source
- Added previously missing RF level value for the optional SAT tuner
- Added SAT tuner alarms for RF level, C/N and TS Sync
- Added Mono Downmix option for the audio outputs
- Major Livewire integration enhancements:
 - Added optional Livewire Sources for the audio outputs (instead of AES67 streams), allowing to have a Livewire audio stream instead of physical XLR as audio output.
 - Added Livewire level meters for Sources and Destinations (enhance compatibility to e. g. Pathfinder)
 - Added two virtual Livewire GPI ports (GPI 3 and 4), which will reflect the state of GPO port 1 and 2. This will allow other Livewire devices to register for GPI changes via snake mode and thereby follow a GPO change on the SAT-4d (e. g. via GPIO Tunneling), reflected as a virtual GPI change. The virtual GPI ports will thereby provide a GPO pass-through to other Livewire devices.
- Added status tabs to Overview page for optional AES67 outputs and Livewire Sources
- Added PIN lock option for LCD menu
- Allow decoding of not announced TS audio services (with missing DVB tables)
The codec has to be set manually ("Automatic" will not work)
- Added VLAN interface status

Changed functionality

- Improved the file upload via the Storage page
The upload limit was increased to 100 MB and the error handling was improved.
- The "NTP Server Quality" parameter options are renamed from "Internet" and "Local" to "Logging" and "Clock Source" to better describe the usage and thereby the internal evaluation parameters used. With NTP expert settings enabled you can now also change the NTP quality settings "RMS Offset" and "Skew" (used as evaluation parameters).
NTP validation is now much faster on device startup or NTP activation.

Fixed Issues

- Fixed a possible crash with NTP synchronization and "Bind to interface" option enabled
- When loading a settings file, some input sources may not show up, although there were such input sources in the settings file (probably only TS/SAT and Radio)



IP-4d Release Notes

- SAT tuner: there was a LNB supply limitation of 200mA, which led to compatibility issues to some LNBs (not switching polarization). This limitation is removed by software, allowing for a current > 400mA
- SAT input sources: Fixed a possible larger offset of the audio buffer level with certain streams
- Fixed an issue with syslog messages stop working after a reboot
- Fixed a possible crash on the Overview page, when RTP with dual streaming, VLAN and multicast is enabled
- Fix input source assignment check for SAT input sources (did not allow some valid combinations)
- Fix xHE-AAC problems with low bitrates
- Icecast input source handling improved for faulty meta data from some Icecast servers
- Improved Icecast client compatibility to “bursty” Icecast streams similar to HLS
- IGMP binding improved for RTP multicast (in case of interfaces with identical addresses)
- Livewire: increased general compatibility with Pathfinder
- Livewire: changes done to Livewire Destinations via LWRP were not applied
- AES67 output compatible with DHD (silent mode)
- AES67 outputs loose the PTP synchronization after reconfiguration the AES67 output parameters
- AES67 output: improve stability of empty packets mode
- Fixed an issue with the ancillary output not working and providing no data when a TS ancillary data or a private data input source is configured and only assigned to one of the ancillary outputs without using the same TS source in one of the decoders (or maybe encoders)
- TS/Demux: In “Service (auto)” mode the PID shown in the input source table was the PMT PID and not the audio PID
- TS/Demux: Fix decoding startup problems with “Service (auto)” mode
- TS/Demux config: Fix empty audio track select on config mode change from “Service (auto)” to “Service (fixed)”
- SAP: fixed crash with too many announced streams

Known bugs

- xHE-AAC: Ancillary data and GPIO Forwarding does not work